E. 6th Avenue

Vehicle Gate Bollards Existing Vegetation Timber Edging -Dog Station Baseball Field , trashcan Asphalt Trail Existing Vegetation Concrete pad -Picnic Table icnic Shelter

Setting

Outer Park Edges & Entry

The north side of the park is bordered by E. 6th. Native forest borders the west, south, and southeast sides.

Active Recreation Areas

Activie areas include: Play Structure 5-12, Play Structure for 2-5 year olds, Play Fields, Little League Baseball Field, and Tennis

Passive Recreation Areas

Benches Picnic Tables

Pathways

Asphalt trails on the west, south, and east perimeters. Condition fair to poor. Cracks, heaving and plant root damage has created tripping hazzards.

Green Space

Open lawn areas

Playgrounds

Equipment List

	No.	Item	Description	
	1	Big Toy Play Structure	ages 5-12, xx events, metal/wood, multiple play events	Appearance 4; Safety 2; Activities 4
	2	Big Toy Play Structure	ages 2-5, xx events, metal/wood, multiple play events	Appearance 1; Safety 1; Activities 4
	3	Safety Surface	rubber tile	Appearance 1; Safety 1
	4	Safety Surface	pea gravel	Poor condition, plants growlng at edges

Issues/Concerns Notes

Play equipment was reviewed using three criteria: appearance, safety, and activities.

Appearance - A ranking of 5 means the equipment is still vibrant in color, not overly faded, chipped, and with little to no graffitti. The lowest ranking, 1, indicates appearance is contributing in a negative way to the park atmosphere. This includes extensive graffitti, chipped and worn surfaces to the extent the user might be inhibited using an otherwise safe piece of equipment

Safety - Equipment was not technically evaluated for safety. A 5 ranking means the equipment does not have obvious entrapments, protrusions, rough or worn edges, or hazardous splintering. A ranking of 1 means the equipment should be reviewed in detail, it is missing play elements creating a safety issue or the use of the equipment could lead to an injury.

Activities - Includes an overview of the play elements and ages served for each individual piece and the grouping of play pieces. A ranking of 5 indicates the piece is of high value and provides interesting, usable play elements. A ranking of 1 indicates the equipment does not meet user needs in terms of activities it offers and thus its play value is almost nil.

Accessibility Overview

Equipment does not meet 50% requirement for ADA. Needs accessible swing element; play structure needs to be coordinated with manufacturer for ADA upgrades; one spring toy shuld have accessible surfacing.

Overall Park/Area Map

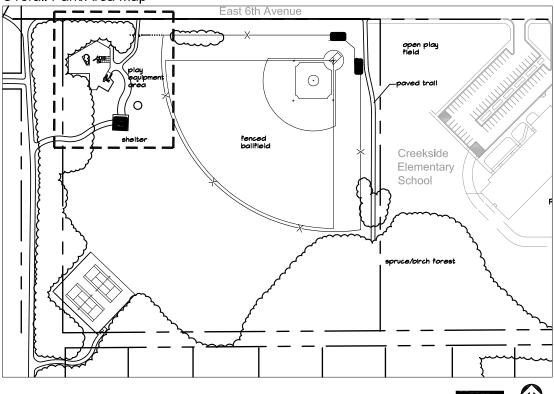



Photo Inventory









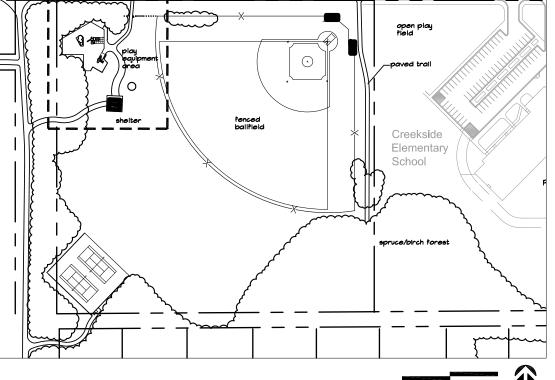

7122 E. 6th Avenue NE Park District Northeast Community Council Legis Dist 19J; Assem Dist 5 8.04 acres

In 1979, land was acquired with bonds and LWCF funds. In 1981, a parking area, picinic area, and landscaping were added to the park.

2008 grade D

Basics



Department of Parks and



NE Park District

Creekside Park Site Inventory L1.0 & Analysis --- x